

Rules and Regulations

Federal Register

Vol. 88, No. 47

Friday, March 10, 2023

This section of the FEDERAL REGISTER contains regulatory documents having general applicability and legal effect, most of which are keyed to and codified in the Code of Federal Regulations, which is published under 50 titles pursuant to 44 U.S.C. 1510.

The Code of Federal Regulations is sold by the Superintendent of Documents.

FEDERAL HOUSING FINANCE AGENCY

12 CFR Part 1238

[No. 2023–N–4]

Orders: Reporting by Regulated Entities of Stress Testing Results as of December 31, 2022; Summary Instructions and Guidance

AGENCY: Federal Housing Finance Agency.

ACTION: Orders.

SUMMARY: In this document, the Federal Housing Finance Agency (FHFA) provides notice that it issued Orders, dated March 7, 2023, with respect to stress test reporting as of December 31, 2022, under section 165(i)(2) of the Dodd-Frank Wall Street Reform and Consumer Protection Act (Dodd-Frank Act), as amended by section 401 of the Economic Growth, Regulatory Relief, and Consumer Protection Act (EGRRCPA). Summary Instructions and Guidance accompanied the Orders to provide testing scenarios.

DATES: Each Order is applicable March 7, 2023.

FOR FURTHER INFORMATION CONTACT: John Williams, Associate Director, Office of Capital Policy, (202) 649–3159, John.Williams@fha.gov; Sara L. Todd, Assistant General Counsel, Office of General Counsel, (202) 649–3527, Sara.Todd@fha.gov; or James Jordan, Deputy General Counsel, Office of General Counsel, (202) 649–3570, James.Jordan@fha.gov. For TTY/TRS users with hearing and speech disabilities, dial 711 and ask to be connected to any of the contact numbers above.

SUPPLEMENTARY INFORMATION:

I. Background

FHFA is responsible for ensuring that the regulated entities operate in a safe and sound manner, including the maintenance of adequate capital and

internal controls, that their operations and activities foster liquid, efficient, competitive, and resilient national housing finance markets, and that they carry out their public policy missions through authorized activities. See 12 U.S.C. 4513. These Orders are being issued under 12 U.S.C. 4516(a), which authorizes the Director of FHFA to require by Order that the regulated entities submit regular or special reports to FHFA and establishes remedies and procedures for failing to make reports required by Order. The Orders, through the accompanying Summary Instructions and Guidance, prescribe for the regulated entities the scenarios to be used for stress testing. The Summary Instructions and Guidance also provides to the regulated entities advice concerning the content and format of reports required by the Orders and the rule.

II. Orders, Summary Instructions and Guidance

For the convenience of the affected parties and the public, the text of the Orders follows below in its entirety. The Orders and Summary Instructions and Guidance are also available for public inspection and copying at the Federal Housing Finance Agency's Freedom of Information Act (FOIA) Reading Room at <https://www.fhfa.gov/AboutUs/FOIAPrivacy/Pages/Reading-Room.aspx> by clicking on "Click here to view Orders" under the Final Opinions and Orders heading. You may also access these documents at <http://www.fhfa.gov/SupervisionRegulation/DoddFrankActStressTests>.

The text of the Orders is as follows:

Federal Housing Finance Agency

Order Nos. 2023–OR–FNMA–1 and 2023–OR–FHLMC–1

Reporting by Regulated Entities of Stress Testing Results as of December 31, 2022

Whereas, section 165(i)(2) of the Dodd-Frank Wall Street Reform and Consumer Protection Act ("Dodd-Frank Act"), as amended by section 401 of the Economic Growth, Regulatory Relief, and Consumer Protection Act ("EGRRCPA") requires certain financial companies with total consolidated assets of more than \$250 billion, and which are regulated by a primary Federal financial regulatory agency, to conduct periodic stress tests to determine whether the companies have

the capital necessary to absorb losses as a result of severely adverse economic conditions;

Whereas, FHFA's rule implementing section 165(i)(2) of the Dodd-Frank Act, as amended by section 401 of EGRRCPA is codified as 12 CFR 1238 and requires that "[e]ach Enterprise must file a report in the manner and form established by FHFA." 12 CFR 1238.5(b);

Whereas, The Board of Governors of the Federal Reserve System issued stress testing scenarios on February 9, 2023; and

Whereas, section 1314 of the Safety and Soundness Act, 12 U.S.C. 4514(a) authorizes the Director of FHFA to require regulated entities, by general or specific order, to submit such reports on their management, activities, and operation as the Director considers appropriate.

Now therefore, it is hereby Ordered as follows:

Each Enterprise shall report to FHFA and to the Board of Governors of the Federal Reserve System the results of the stress testing as required by 12 CFR 1238, in the form and with the content described therein and in the Summary Instructions and Guidance, with Appendices 1 through 7 thereto, accompanying this Order and dated March 7, 2023.

It Is So Ordered, this the 7th day of March, 2023.

This Order is effective immediately.

Signed at Washington, DC, this 7th day of March, 2023.

Sandra L. Thompson,

Director, Federal Housing Finance Agency.

Sandra L. Thompson,

Director, Federal Housing Finance Agency.

[FR Doc. 2023–04980 Filed 3–9–23; 8:45 am]

BILLING CODE 8070–01–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2023–0423; Project Identifier AD–2022–01525–E; Amendment 39–22366; AD 2023–04–19]

RIN 2120–AA64

Airworthiness Directives; General Electric Company Turbofan Engines

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule; request for comments.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for certain General Electric Company (GE) GE90–110B1 and GE90–115B model turbofan engines. This AD was prompted by a manufacturer investigation which discovered that florescent penetrant inspections (FPI) were not performed on the dovetail pressure face of certain high-pressure compressor (HPC) rotor spools at overhaul. This AD requires FPI of the affected HPC rotor stage 7–9 spool and, depending on the results of the inspection, replacement with a part eligible for installation. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective March 27, 2023.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of March 27, 2023.

The FAA must receive comments on this AD by April 24, 2023.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to *regulations.gov*. Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at *regulations.gov* by searching for and locating Docket No. FAA–2023–0423; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, any comments received, and other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference

- For service information identified in this final rule, contact General Electric Company, GE Aviation, Room 285, 1 Neumann Way, Cincinnati, OH 45215; phone: (513) 552–3272; email: *aviation.fleetsupport@ge.com*.

- You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the

FAA, call (817) 222–5110. It is also available at *regulations.gov* by searching for and locating Docket No. FAA–2023–0423.

FOR FURTHER INFORMATION CONTACT:

Stephen Elwin, Aviation Safety Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA 01803; phone: (781) 238–7236; email: *Stephen.L.Elwin@faa.gov*.

SUPPLEMENTARY INFORMATION:

Background

The FAA received a report that a GE overhaul shop internal investigation found that several HPC rotor stage 7–9 spools were shipped to operators prior to a final FPI being performed on the dovetail pressure face. A final FPI is performed to confirm that any linear indications have been removed, as indications on the HPC rotor stage 7–9 spool may potentially propagate and eventually lead to failure of the HPC rotor stage 7–9 spool. This condition, if not addressed, could result in an in-flight shutdown, damage to the engine, and damage to the airplane. The FAA is issuing this AD to address the unsafe condition on these products.

FAA’s Determination

The FAA is issuing this AD because the agency has determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Related Service Information Under 14 CFR Part 51

The FAA reviewed GE GE90–100 Service Bulletin 72–0905 R00, dated July 25, 2022. This service information specifies procedures for performing a piece-part inspection of the affected HPC rotor stage 7–9 spools. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in **ADDRESSES**.

AD Requirements

This AD requires, at the next shop visit after the effective date of this AD, performing an FPI of each affected HPC rotor stage 7–9 spool and, depending on the results of the inspection, replacement with a part eligible for installation.

Justification for Immediate Adoption and Determination of the Effective Date

Section 553(b)(3)(B) of the Administrative Procedure Act (APA) (5 U.S.C. 551 *et seq.*) authorizes agencies to dispense with notice and comment procedures for rules when the agency, for “good cause,” finds that those

procedures are “impracticable, unnecessary, or contrary to the public interest.” Under this section, an agency, upon finding good cause, may issue a final rule without providing notice and seeking comment prior to issuance. Further, section 553(d) of the APA authorizes agencies to make rules effective in less than thirty days, upon a finding of good cause.

The FAA has found the risk to the flying public justifies waiving notice and comment prior to adoption of this rule because no domestic operators use this product. It is unlikely that the FAA will receive any adverse comments or useful information about this AD from any U.S. operator. Accordingly, notice and opportunity for prior public comment are unnecessary, pursuant to 5 U.S.C. 553(b)(3)(B). In addition, for the foregoing reason(s), the FAA finds that good cause exists pursuant to 5 U.S.C. 553(d) for making this amendment effective in less than 30 days.

Comments Invited

The FAA invites you to send any written data, views, or arguments about this final rule. Send your comments to an address listed under **ADDRESSES**. Include “FAA–2023–0423 Project Identifier AD–2022–01525–E” at the beginning of your comments. The most helpful comments reference a specific portion of the final rule, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this final rule because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to *regulations.gov*, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this final rule.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this AD contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this AD, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA

will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this AD. Submissions containing CBI should be sent to Stephen Elwin, Aviation Safety Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA 01803. Any commentary that the FAA receives which is not specifically

designated as CBI will be placed in the public docket for this rulemaking.

Regulatory Flexibility Act

The requirements of the Regulatory Flexibility Act (RFA) do not apply when an agency finds good cause pursuant to 5 U.S.C. 553 to adopt a rule without prior notice and comment. Because FAA has determined that it has good cause to

adopt this rule without prior notice and comment, RFA analysis is not required.

Costs of Compliance

The FAA estimates that this AD affects 0 engines installed on airplanes of U.S. registry.

The FAA estimates the following costs to comply with this AD:

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Perform an FPI of the HPC rotor stage 7–9 spool.	5 work-hours × \$85 per hour = \$425	\$0	\$425	\$0

The FAA estimates the following costs to do any necessary replacements that would be required based on the

results of the inspection. The agency has no way of determining the number of

aircraft that might need these replacements:

ON-CONDITION COSTS

Action	Labor cost	Parts cost	Cost per product
Replace the HPC rotor stage 7–9 spool	40 work-hours × \$85 per hour = \$3,400	\$1,183,200	\$1,186,600

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866, and
- (2) Will not affect intrastate aviation in Alaska.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

2023–04–19 General Electric Company:

Amendment 39–22366; Docket No. FAA–2023–0423; Project Identifier AD–2022–01525–E.

(a) Effective Date

This airworthiness directive (AD) is effective March 27, 2023.

(b) Affected ADs

None.

(c) Applicability

This AD applies to General Electric Company (GE) GE90–110B1 and GE90–115B model turbofan engines with an installed high-pressure compressor (HPC) rotor stage 7–9 spool with part number (P/N) 2032M23G01, P/N 2032M23G02, P/N 2676M00G01, or P/N 2676M00G02, and a serial number listed in paragraph 4., Appendix—A, Table 1 of GE GE90–100 Service Bulletin (SB) 72–0905 R00, dated July 25, 2022 (GE SB 72–0905).

(d) Subject

Joint Aircraft System Component (JASC) Code 7230, Turbine Engine Compressor Section.

(e) Unsafe Condition

This AD was prompted by a manufacturer investigation which revealed that florescent penetrant inspections (FPI) were not performed on the dovetail pressure face of certain HPC rotor stage 7–9 spools at overhaul. The FAA is issuing this AD to prevent the failure of the HPC rotor stage 7–9 spool. The unsafe condition, if not addressed, could result in an in-flight shutdown, damage to the engine, and damage to the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

(1) At the next engine shop visit after the effective date of this AD, perform an FPI of the dovetail pressure face of the affected HPC rotor stage 7–9 spool in accordance with the

Accomplishment Instructions, paragraph 3.A.(1)(a) of GE SB 72–0905.

(2) If, during the FPI required by paragraph (g)(1) of this AD, the HPC rotor stage 7–9 spool does not meet the part serviceability criteria in the Accomplishment Instructions, paragraph 3.A.(1)(a) of GE SB 72–0905, before further flight, replace the compressor rotor stage 7–9 spool with a part eligible for installation.

(h) Definition

For the purpose of this AD, an “engine shop visit” is the induction of an engine into the shop for maintenance involving separation of pairs of major mating engine flanges, except for the following situations, which do not constitute an engine shop visit:

- (i) Separation of engine flanges solely for the purposes of transportation of the engine without subsequent maintenance; or
- (ii) Separation of engine flanges solely for the purpose of replacing the fan or propulsor without subsequent maintenance.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, ECO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j) of this AD and email it to: ANE-AD-AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(j) Related Information

For more information about this AD, contact Stephen Elwin, Aviation Safety Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA 01803; phone: (781) 238–7236; email: Stephen.L.Elwin@faa.gov.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) GE GE90–100 Service Bulletin 72–0905 R00, dated July 25, 2022.

(ii) [Reserved]

(3) For GE service information identified in this AD, contact General Electric Company, 1 Neumann Way, Cincinnati, OH 45215; phone: (513) 552–3272; email: aviation.fleetssupport@ae.ge.com; website: ge.com.

(4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the FAA, call (817) 222–5110.

(5) You may view this service information that is incorporated by reference at the

National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email: fr.inspection@nara.gov, or go to: www.archives.gov/federal-register/cfr/ibr-locations.html.

Issued on February 25, 2023.

Christina Underwood,
Acting Director, Compliance & Airworthiness
Division, Aircraft Certification Service.

[FR Doc. 2023–04869 Filed 3–9–23; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. **FAA–2022–1058**; Project Identifier **AD–2022–00256–T**; Amendment **39–22340**; AD **2023–03–15**]

RIN 2120–AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: The FAA is superseding Airworthiness Directive (AD) 2021–07–09, which applies to all The Boeing Company Model 747–100, 747–100B, 747–100B SUD, 747–200B, 747–200C, 747–200F, 747–300, 747–400, 747–400D, 747–400F, 747SR, and 747SP series airplanes. AD 2021–07–09 required repetitively inspecting all trim air diffuser ducts or sidewall riser duct assemblies (collectively referred to as TADDs) for damage, including repetitive structural inspections of the center fuel tanks for damage, and performing applicable on-condition actions. Since the FAA issued AD 2021–07–09, the agency has determined that the existing requirements do not adequately address the unsafe condition. This AD continues to require repetitive inspections of the TADDs for damage, with revised compliance times, and repair if applicable. This AD also requires repetitive replacement of the TADDs and removes the structural inspections of the center fuel tanks. This AD also prohibits the installation of affected parts. This AD removes certain airplanes from the applicability. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective April 14, 2023.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD as of April 14, 2023.

ADDRESSES:

AD Docket: You may examine the AD docket at regulations.gov under Docket No. FAA–2022–1058; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

Material Incorporated by Reference:

- For service information identified in this final rule, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; internet myboeingfleet.com.

- You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. It is also available at regulations.gov under Docket No. FAA–2022–1058.

FOR FURTHER INFORMATION CONTACT:

Nicole S. Tsang, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone: 206–231–3959; email: nicole.s.tsang@faa.gov.

SUPPLEMENTARY INFORMATION:

Background

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to supersede AD 2021–07–09, Amendment 39–21486 (86 FR 17899, April 7, 2021) (AD 2021–07–09). AD 2021–07–09 applied to all The Boeing Company Model 747–100, 747–100B, 747–100B SUD, 747–200B, 747–200C, 747–200F, 747–300, 747–400, 747–400D, 747–400F, 747SR, and 747SP series airplanes. The NPRM published in the **Federal Register** on September 8, 2022 (87 FR 54919). The NPRM was prompted by reports of sealant deteriorating on the outside of the center wing fuel tank and analysis showing that sealant may deteriorate inside the tank due to excess heat from TADDs. The NPRM was also prompted by reports indicating that the high temperature composite material TADD failed. AD 2021–07–09 requires replacing original fiberglass fabric material with high temperature composite material TADDs, repetitively inspecting the TADDs for damage, and